PROGRESSIVE INDEX FOR 1963 SERVICE LETTERS

The following codings are used to indicate the models to which this index applies:—

A	"Anglia" Range	D "Zephyr 4/6" and "Zodiac" Mk. III
В	"Consul Cortina" Range	Ranges
C	"Consul 315" and "Capri"	G All Passanger Car models

SUBJECT				MODEL CODE AND SERVICE LETTER No.							
Wheels—Hubs											
Brakes				'							
Front Ayle Steering Gear											
Rear Axle											
Frame—Springs											
Engine											
Gearbox-Clutch				D2, A	3, C4						
Cooling System				A5, B							
Fuel System											
Electrical System				A12							
Accessories				A1. G	8. G9.	G10, 0					
Bodywork, Mudguards-Bonnet											
General Data											

Last Issue: No. 11-Faulty Loudspeakers-All models

WIRING LOOM CONNECTIONS



"Anglia Super"

Service Letter No. 13 (Export) 1961 Series, describes how standard wiring loom pliers could be reworked to enable them to "press fully home" the type of snap terminal which has separate connector sleeves.

An additional type of snap connector is now used on certain models in production and this has moulded insulation on the snap terminals and connector sleeves. Although this method of construction reduces the possibility of short circuits should the terminals not be pressed fully home, wiring loom pliers should still be used to ensure correct assembly.

Existing loom pliers, as illustrated in Service Letter No. 13 (Export) 1961 Series, may be further modified for the latest connectors by welding or brazing a suitable spade end onto the plier handles, as illustrated in Fig. 1 (overleaf).

Pliers incorporating the modified ends for both snap type terminals and moulded type terminals can be obtained through normal factors for this type of equipment.

WIRING LOOM CONNECTIONS—(Cont'd.)

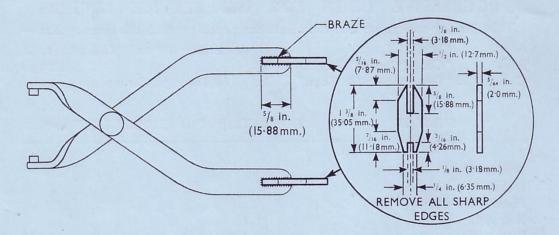


Fig. 1. Modified Loom Pliers for Moulded Type Terminals

The foregoing is for Dealer Information Only. Without exception all gratis repairs and replacements are subject to the current Warranty and Policy procedure.